POWER PINNER 7105 GLIDER OPERATOR'S MANUAL



Copyright: January 23, 2005 Revised: 5-9-08

TABLE OF CONTENTS

INTRODUCT	TON	3
OPERATOR S	SAFETY	3
SYSTEM REC	QUIREMENTS	4
INSTALLATI	ION INSTRUCTIONS	4-5
MAINTENAN	NCE	5
TROUBLESH	IOOTING	6
SYSTEM OPE	ERATIONS/ COMPONENT IDENTIFICATION	
	WELD SETTING ADJUSTMENTS	7
	DRIVE HEAD ASSEMBLY	8
	LOAD CYLINDER ASSEMBLY	9-10
	PROXIMITY SENSOR	10
	ELECTRICAL ASSEMBLY	11
	CONTROL ENCLOSURE	12
	PRESSURE REGULATOR	13
	FOOT PEDAL	14
	ELECTRICAL SCHEMATIC	15–16
	PNEUMATIC DIAGRAM	17
PARTS LIST		18
SERVICE PO	LICY	19
WARRANTY	,	20

INTRODUCTION

The Gripnail 7105 power pinner glider was designed to require minimum maintenance. The 7105 is PLC controlled, which simplifies trouble shooting. All hose connections between valves and cylinders use push-fit type fittings. These fittings save maintenance time if lubrication or replacement is required on any item.

OPERATOR SAFETY

Proper safety precautions must be observed with any piece of equipment. This section contains several guidelines designed to ensure operator safety. Follow these directions at all times.

REMEMBER—SAFETY FIRST!

FIVE SAFETY RULES

- 1. DO NOT OPERATE this machine without all covers and guards in place.
- 2. DISCONNECT all electrical power and compressed air sources before servicing. Follow OSHA standard 1910.147 "CONTROL of HAZARDOUS ENERGY (LOCKOUT/TAGOUT)"
- 3. TROUBLESHOOTING should be done by qualified personnel only.
- 4. THE OPERATOR should always wear the personal protective equipment as outlined by his/her employer, such as eye and ear protection, to avoid injury.
- 5. MAINTAIN the equipment in good operating condition.

SYSTEM REQUIREMENTS

ELECTRICAL: 190, 208, 230 VAC/60 HZ/1Ø

31.0, 28.4, 25.5 AMPS

(Recommend using a 50 Amp, slow blow Disconnect)

PNEUMATIC: 40-85 PSI @ 1 CFM

INSTALLATION INSTRUCTIONS

- 1. Place machine on a hard, flat, level surface. If the surface is irregular and shimming is required, use steel (sheet metal) to make shims. Normal vibratory parts feeder operation requires the machine to be stable and solidly supported. **DO NOT USE** cardboard, plywood, particle board, other composite wood products or soft materials as shim stock.
- 2. Place bowl feeder on machine into spaces provided, noting location of bowl exit. Plug the bowl feeder into the socket near the bowl support.
- 3. Ensure a 1/8 inch clearance gap exists between the feeder bowl exit and the entrance to the track assembly.
- 4. Connect air. Safety Note: Quick disconnect air fittings are recommended. ALWAYS install the *free flowing* MALE connector onto the machine. This will permit immediate exhausting of air from the machine when disconnected from the shop supply.
- 5. Connect electricity to the disconnect switch located inside the Electrical Enclosure on the door. (See Figure 1) Measure the voltage at the customer supplied fused disconnect. Set the jumper on the terminal strip (190, 208 or 230) to match the incoming voltage.

INCOMING POWER - CONNECTION

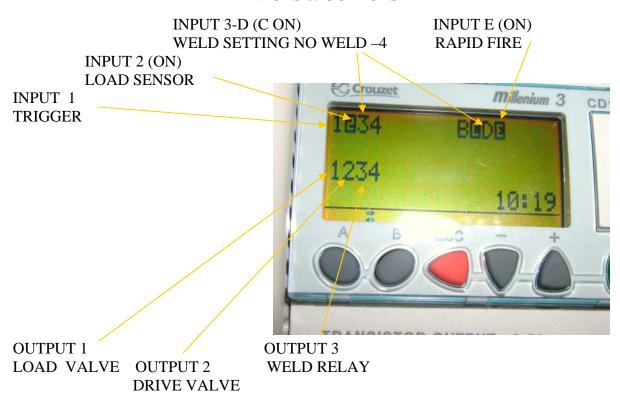


Figure 1

MAINTENANCE

- 1. DRAIN water from filter/regulator assembly DAILY.
- 2. REMOVE accumulated fiberglass and adhesive buildup from the magnetic driver and track daily or as required.
- 3. Check for loose hardware and tighten as required.

PLC INPUTS & OUTPUTS



SEQUENCE OF OPERATION

- 1. Input 2 (Load Sensor) AND Input 3 OR 4 OR B OR C OR D MUST be on.
- 2. Input 1 (Foot or Trigger) is activated momentarily or continuously held.
- 3. Output 2 (Drive) turns on.
- 4. Output 3 (Weld Relay) turns on and stays on based on the time setting from Input 3-D.
- 5. Output 3 (Weld Relay) turns off.
- 6. Output 2 (Drive) turns off.
- 7. Output 1 (Load) turns on.
- 8. Input 2 (Load Sensor) turns off.
- 9. Output 1 (Load) turns off.
- 10. Input 2 (Load Sensor) turns on.
- 11. Input 1 (Foot or Trigger) must be off after Step 9 to restart the sequence (if RAPID FIRE off).

TROUBLESHOOTING

A. Drive head doesn't operate after foot pedal or triggers are depressed.

- 1. Check incoming power connection and ON switch. Page 5 & 12.
- 2. Is air connection and/or shop supply valve open?
- 3. Is the load sensor indicator lights ON? Page 10.
 - a. If not ON, check the sensor position.
 - b. If not ON, check 24 Volt DC power supply in control box. Page 11.
- 4. Check drive valve fuse #3.
- 5. Is the foot pedal/trigger input light (I1) and drive valve output light (O2) ON when the foot pedal/trigger is depressed. Page 11.
- 6. Check internal connections in foot pedal/trigger and external cable condition. Page 14.

B. New weld pins do not load onto drive head.

- 1. Check the drive cylinder and magnetic driver. If <u>either</u> is discovered loose, readjust and tighten. See page 8.
- 2. Check load valve fuse #4.
- 3. Turn OFF all power and air, then manually check load cylinder for binding.

C. Vibratory feeder bowl doesn't operate.

- 1. Check the power cord connection.
- 2. Check the position of the speed control setting.
- 3. Check the sensor on track.
- 4. Check the feeder bowl control fuse (3 amp). Page 11

D. Improper weld.

- 1. Adjust weld setting. Page 12.
- 2. Clean upper and lower weld tips.
- 3. Check the weld transformer is set on the correct taps to match incoming voltage.

WELD SETTING ADJUSTMENTS

1. With the power "ON', set the WELD SETTING switch to correspond to the pin being fastened. (Note: These setting are reference starting points only.)


PIN	SETTING	
57	1	
107	1-2	
127	2	
137	2-3	
157	3	
207	4	

- 2. Place the sheet metal flat on the lower weld tip or anvil and press the foot pedal.
- 3. Make several test welds to insure uniform and proper weld.
- 4. The WELD SETTING switch also has a NO WELD position. This disables the weld circuit to test functions of the rest of the machine cycle.

DRIVE HEAD ASSEMBLY

DRIVE VALVE P/N 44240

DRIVE CYLINDER P/N 44267

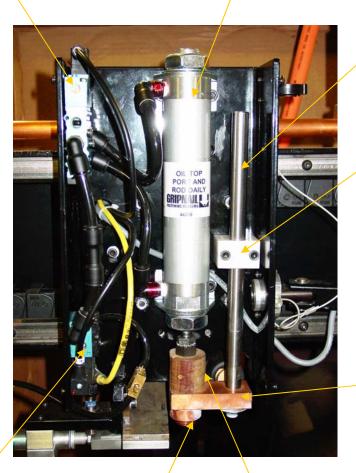

GUIDE ROD P/N 31351 :31-18x1.25 SHCS P/N 60175 .31 LOCK WASHER P/N 61205

ROD GUIDE P/N 31299 .25-20x2.00 SHCS P/N 60112


WELD TIP ADAPTER P/N 31350 .25-20x1.00 SHCS P/N 60120

LOAD VALVE P/N 44251

> UPPER WELD TIP P/N 31011


INSULATOR ASSY P/N 20363 10-32x1.50 SHCS P/N 60165

LOAD CYLINDER ASSEMBLY

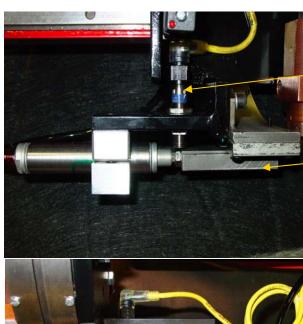


PROXIMITY SENSOR P/N 51268

TRANSFER BLOCK P/N 20441

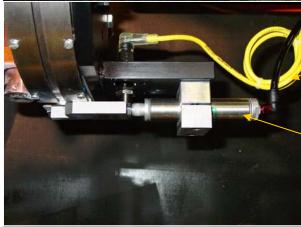


PROXIMITY SENSOR CABLE P/N 51269

> LOAD CYLINDER P/N 44257

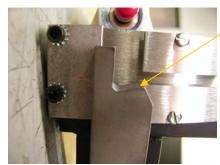


Position the Transfer Block so this point intrudes on the Pin path by approximately 1/32".

Rotate the Transfer Block to horizontal, to assure the top key section equally engages the bottom of the Track.

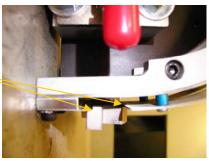



LOWER WELD TIP P/N 31032

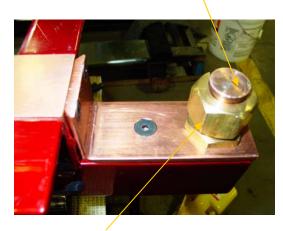

ELECTRODE NUT P/N 31278

The transfer block fits into the track for easy alignment.

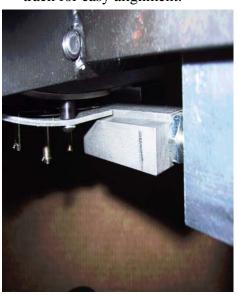

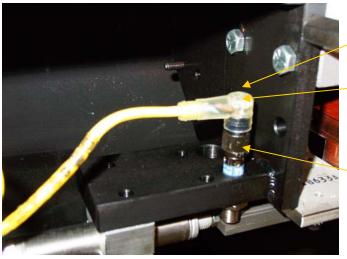


GREEN LED

YELLOW LED

LOAD SENSOR

ELECTRICAL ASSEMBLY

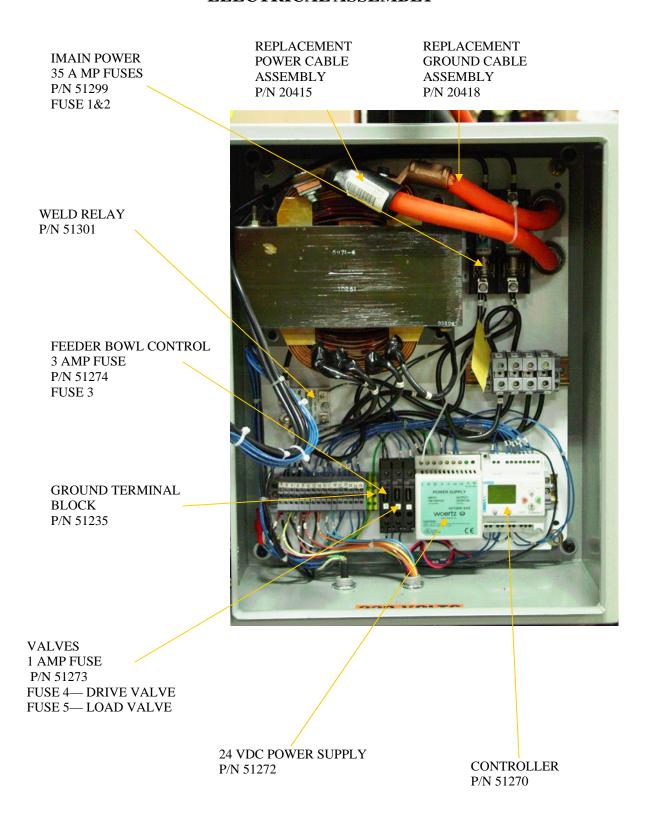


Pictured below are the machine's electrical controls.

The vibratory feeder speed control is used to optimism the bowl feed rate.

The digital volt meter monitors the incoming voltage.

The weld setting switch is adjusted based on weld pin and gauge.

The main disconnect switch applies power to the machine, and also provides a means for LO/TO for the electrical power.

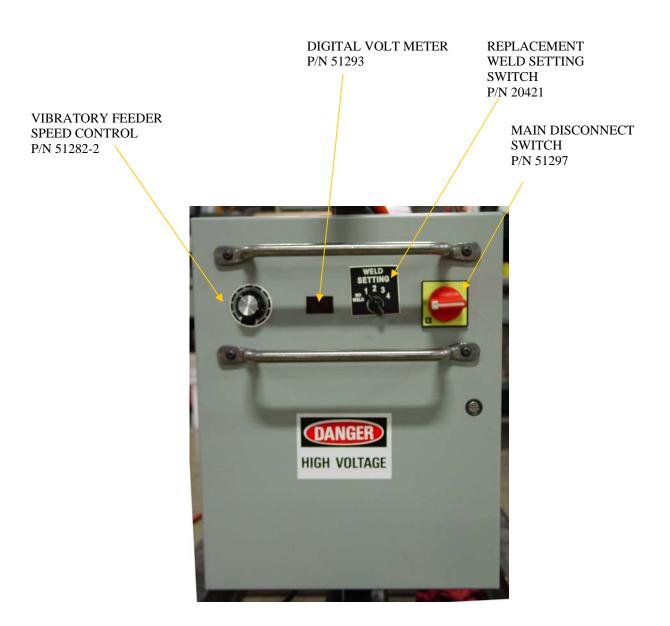

PRESSURE REGULATOR

BRACKET W/ NUT P/N 42445



FILTER/ REGULATOR P/N 40206 REGULATOR GAGE P/N 44120

FOOT PEDAL

NOTE: RELEASE pedal completely after each cycle (except in RAPID FIRE mode. Both air and electrical power must be on to operate foot pedal.





FOOT PEDAL INTERNAL CONNECTIONS USE NORMALLY OPEN TERMINALS




ELECTRICAL SCHEMATIC

190/208/230VAC-60HZ-1D/31.0/28.4/25.5AMP

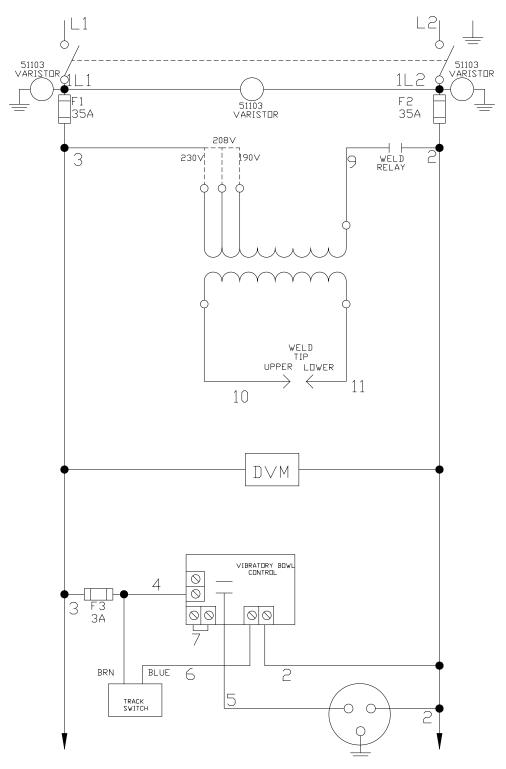

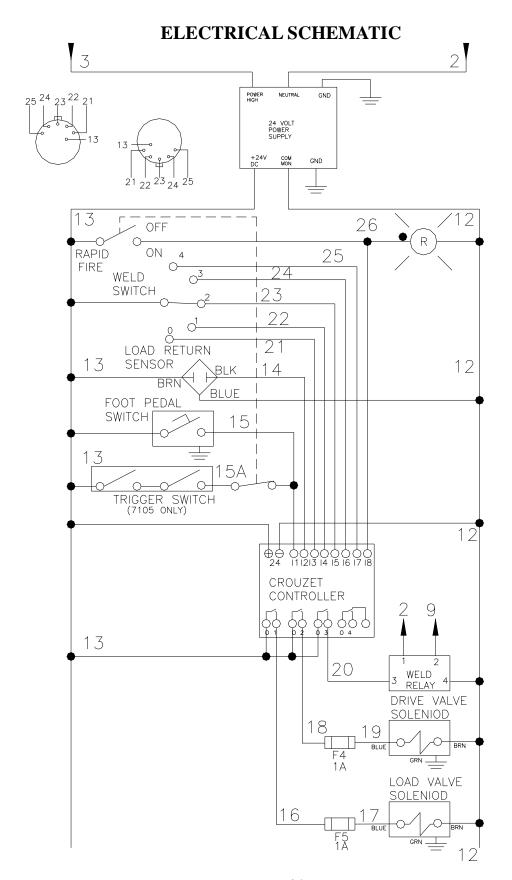

PNEUMATIC DIAGRAM

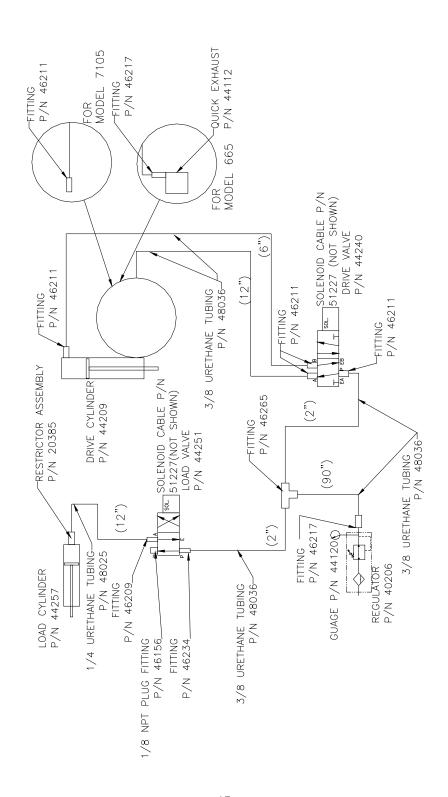

REPLACEMENT PARTS LIST

ITEM#	PART#	DESCRIPTION	QTY (EA OR FT)
1	31361	Lower Weld Anvil	1
2	51262	Track Sensor	1
3	51302	Trigger Assembly	1
4	31278	Electrode nut	1
5	31032	Lower Weld Tip	1
6	31011	Upper Weld Tip	1
7	20346	Up Weld Tip & Magnet	1
8	48025	Tubing, 1/4" urethane, black	2
9	48036	Tubing, 3/8" urethane, black	20
10	20412	Upper Track Assembly	1
11	20411	Lower Track Assembly	1
12	44267	Drive cylinder	1
13	44257	Load cylinder	1
14	20441	Transfer block	1
15	46211	Elbow, 1/4npt x 3/8 tube	5
16	20277	Feeder bowl assembly	1
17	42361-3	Feeder base 60 HZ	1
18	42361-8	Feeder base 50 HZ	1
19	40206	Filter/ Regulator 1/2 npt	1
20	44120	Gage, regulator 1/4 npt, 0-160 psi	1
21	42515	Deadbolt Latch	1
22	42445	Bracket, wall, with nut	1
23	46209	Elbow, 1/8 npt x 1/4" tube	1
24	44251	Valve, load	1
25	44240	Valve, drive	1
26	51227	Cord set, valve	2
27	51264	Foot pedal	1
28	51268	Load sensor	1
29	51269	Load sensor cable	1
30	51270	Crouzet controller	1
31	51272	Power supply	1
32	51282-2	Control, feeder base	1
33	51273	Fuse 1A, MDL-1	2
34	51299	Fuse 35A, FRN-R-35A	2
35	51274	Fuse, 3A, MDL-3	1
36	50103	Cord, 16/3 SJO	7
37	51301	Weld relay	1
38	20440	Replacement Weld Cable Assembly	1
39	20415	Replacement Weld Power Cable Assembly	1
40	20418	Replacement Weld Ground Cable Assembly	1
41	20421	Replacement Weld Setting Switch Ass'y	1

SERVICE POLICY

Proper operation of your machine is a top priority with the Gripnail Corporation. We will assist you to the best of our abilities to see it is kept in peak operating condition.

In many cases, service needs can be made simply by calling Gripnail Customer Service Department. If it becomes necessary for a service technician to visit your plant, we can make the arrangements.

All Gripnail machines are covered under a one year New Machine Warranty (see Warranty next page). Replacement parts covered by the warranty are supplied free of charge, provided the original parts are returned to Gripnail and do not shown signs of abuse.

At the end of the new machine warranty period, the buyer has the option of purchasing a Limited Extended Parts Warranty. This warranty covers specified machine parts only. Call Gripnail for full details.

All warranties on Gripnail machines are good only if Gripnail fasteners are used. If it is determined that fasteners other than those manufactured by Gripnail have been used, the warranty is voided. At Gripnail, we believe in servicing what we sell for the lifetime of the equipment. If you are having difficulty with your machine or if you have any questions regarding service and warranty policy, please call, fax, or write:

Gripnail Customer Service Department Gripnail Corporation

97 Dexter Road East Providence, Rhode Island 02914 Phone: (800) 474-7624 (401) 431-1791 Fax (401) 438-8520

Email: gripnail@gripnail.com Website: www.gripnail.com

WARRANTY

All Gripnail Fastening Equipment is thoroughly inspected and tested before leaving the factory. Gripnail Corporation warranties its equipment to be free from defects in workmanship and materials under normal and proper use for a period of one (1) year from date of sale to original end purchaser.

The warranty does not apply when repairs or attempted repairs have been made by persons other than Gripnail Corporation's authorized service personnel, or where it is determined by our service personnel that the equipment has been subjected to misuse, negligence or accident. If it is determined that any fasteners other than those manufactured by Gripnail have been used in this machine or tool, the warranty is terminated.

This warranty is not effective unless equipment is properly registered with the factory through the use of warranty information card prior to use. Gripnail Corporation shall not be liable for contingent damages or delays caused by defective materials or any other means beyond our control.

Gripnail Customer Service Department Gripnail Corporation

97 Dexter Road East Providence, Rhode Island 02914 Phone: (800) 474-7624 (401) 431-1791 Fax: (401) 438-8520

Email: gripnail@gripnail.com Website: www.gripnail.com